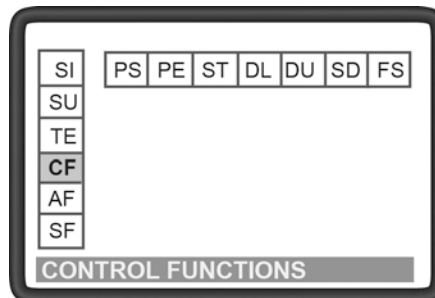**CVTESS CREW KILL MODULE (CKM) Deselect Procedures**

In some instances CVTESS Kits an issue has been identified that may cause the CVTESS to go into Tamper Kill due to a CKM failure. If one of your Bradley or tanks are having recurring Tampering Kills due to a missing CKM, use the following procedures to deselect the CKMs from the system. Prior to doing this procedure, have the crew check to make sure the all of the CKMs actually have batteries. If the CKMs do not have batteries have them install batteries and that may fix the problem. If the CKMs have batteries and the system is still self killing (Tamper kill) then proceed with these steps:
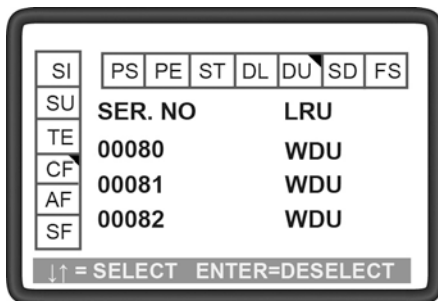
Input Control-On on the Universal Controller Device & shoot a WDU.
Control mode will appear on the CM

Scroll down to the CF menu. Press the enter KEY.
If the ACCESS DENIED pop up appears reshoot a WDU with a control Mode command.

Scroll over to the DU menu and press ENTER then scroll down to highlight a CKM, press ENTER and the selected CKM will be removed from the list and the list will disappear. Press the ENTER key again and scroll down to another CKM and press ENTER. Do this for all the CKMs (the Bradley has 3 and the tank

has 2).

Check the list to make sure that only CKMs were removed. When the CKMs have been removed, the list should contain the following:

Vehicle type	WDUs	LT	CLT	SATs
Abrams	10	1	1	2
Bradley	6	1	0	0

If you have any issues contact a MILES Contact team.